



STANDARD PORTICO DETAILS

TDS-006 Dec 2017

Stage 1 – Columns

Construct column as shown in Technical Data Sheet TDS/002.

Stage 2 – Steel Support

Place support steel onto columns, bolt or build in ends to wall.

Stage 3 – Architrave



Set up timber to support 'L' architrave, lay and line stone dry. Screw threaded rods into cast-in sockets and tighten both nuts over washers. Drill 2 holes into vertical leg of architrave and insert capped dowels. Fill and point perp joints.

Stage 4 – Cornice


Bed cornice onto top plate, insert bolts (2 per stone). Do not over tighten bolts.

Stage 5 – Coping

Lay DPC on cornice and bed coping including fixing dowels.

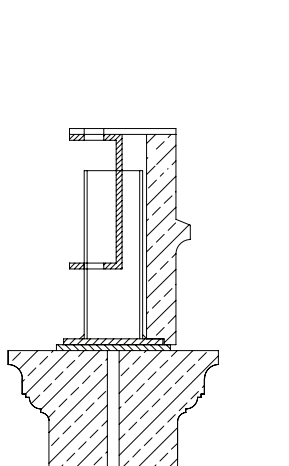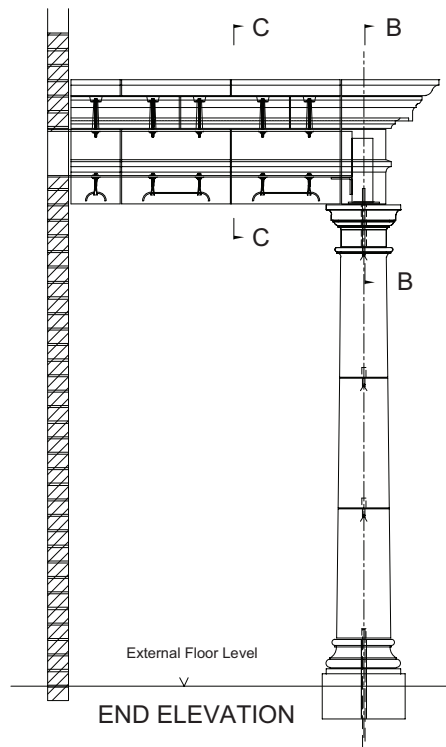

SECTION DETAIL C-C

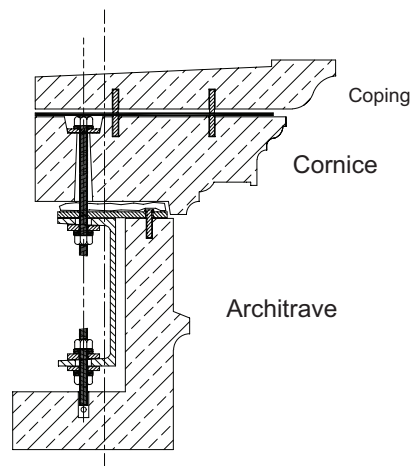

SECTION DETAIL B-B